



X-TYPE

DATE 03/04

XT501-11

**SERVICE**

**TECHNICAL BULLETIN**

Rear Power Windows Inoperative From Rear Doors – Switchpack Isolator Inoperative – Install Modified Window Control Switch

MODEL 2004 MY X-TYPE  
VIN D65151-D87440

**Issue:**

Owners of some 2004 X-TYPE vehicles within the above VIN range, may experience the following concerns:

- The electric windows not working from the rear doors.
- The driver’s door switchpack isolator inoperative.

A modified switch pack is available to address these concerns.

**Action:**

In case of a verified complaint of the above condition on a 2004 X-TYPE within the above VIN range, install a modified driver’s window control switch as described below.

1. Remove front door trim panel (refer to Workshop Manual, JTIS CD ROM, section: 501-05, SRO 76.34.01).
2. Remove window control switch (refer to Workshop Manual, JTIS CD ROM, section: 501-11, SRO 86.25.08).
3. Install new modified window control switch.
4. Install front door trim panel.

**Parts Information:**

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Driver’s window control switch, non-powerfold mirrors with electric rear windows	C2S 27571	1

**Warranty Information:**

Description	SRO	Time	Causal Part Number
Install a new driver’s window control switch, non-powerfold mirrors with electric rear windows	86.25.08	0.5 hrs.	C2S 27571

**NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY “DO-IT-YOURSELFERS.” DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR RETAILER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.**

